STS-110 (BI112) FLIGHT READINESS REVIEW

PROGRAM

March 26, 2002

Solid Rocket Booster



Presenter:
Steve Gordon
Organization/Date:
USA-SRB/3-26-02

New Observations

- STS-110/BI112 RH SRB tilt hydraulic pump contains three replaced inserts
 - All replaced due to documented raised condition

Concern

- Replacement of raised insert not fully enveloped by STS-109/BI111 flight rationale
 - Could result in no preload in joint after replacement due to removal of previously failed threads




Presenter:


Steve Gordon

Organization/Date:

USA-SRB/3-26-02

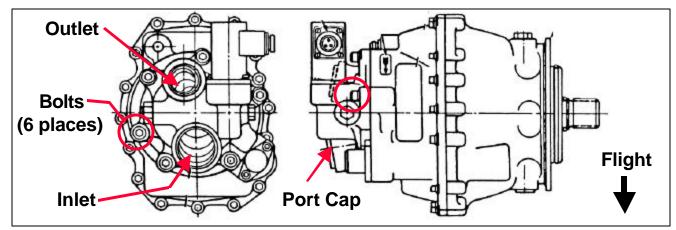



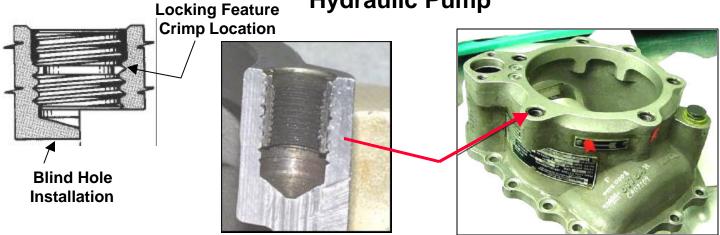

Insert (6 places)

Hydraulic Pump Front Housing




Presenter:

Steve Gordon

Organization/Date:

USA-SRB/3-26-02

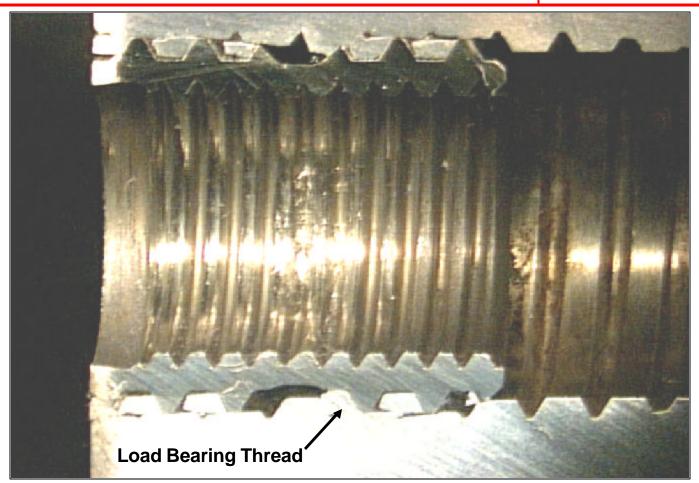

Insert/Housing Cross-Section



Presenter:
Steve Gordon
Organization/Date:
USA-SRB/3-26-02

Worst Case Failure Scenario

- Multiple insert failures allow hydraulic pump port cap separation and external release of hydraulic oil, resulting in aft skirt fire and loss of mission, vehicle and crew
 - Criticality 1

Discussion

- Nondestructive examination of STS-110/BI112 pumps performed
 - Three SRB pumps pass NDE criteria
 - Visible gap between insert and housing
 - No gap visible, evidence of thread contact
 - X-ray review not definitive for two inserts on RH tilt pump
 - All three inserts in question raised, as suspected
 - Unable to verify housing thread configuration at two locations
 - Testing attempted at vendor to replicate worst case condition
 - Hydraulic leakage noted
 - Pump replacement and retest in work
 - X-ray results reveal no raised inserts on replacement pump



Presenter:
Steve Gordon
Organization/Date:
USA-SRB/3-26-02

Discussion (cont.)

- Flight representative testing performed at KSC during ACO
 - Multiple leak checks include low/high speed spins and hot fire
- LCC ensures TVC system operation prior to lift-off
 - Hydraulic pump output pressure verified 2800 3486 psi
 - Reservoir level verified > 50% following APU start
- Further analysis indicates that SRB ATP proof testing fully encompasses flight dynamic loads at port cap interface Corrective Actions
- Design team working short and long term corrective action
- X-ray planned for all assembled pumps until corrective action in place
- Process review underway at vendor
 - Currently under stop work order



Presenter:
Steve Gordon
Organization/Date:
USA-SRB/3-26-02

Rationale for Flight

- SRB pumps refurbished and successfully complete acceptance testing prior to every flight
 - Including proof pressure test
- SRB pumps successfully complete ACO testing prior to each flight
 - Including multiple leak checks and hot fire
- Analysis indicates acceptance testing loads envelope flight loads for SRB pumps
- LCC ensures satisfactory SRB TVC system performance prior to lift-off
- X-ray results show configuration of all four pumps satisfactory for flight
- STS-110/BI112 safe to fly with no increased risk



READINESS ASSESSMENT

Presenter:
Steve Gordon
Organization/Date:
USA-SRB/3-26-02

 Pending completion of planned open work, hydraulic pump replacement and successful pump retest, there are no constraints to flight for STS-110

STS-110 (BI112) Flight Readiness Review

Pending completion of normal operations flow, we certify the Booster Assembly hardware ready to support the launch of STS-110

Gordon P. Nielsen Associate Program Manager/USA SRB Element A.A. McCool

Acting Manager,

SRB Project Office

